


Side Windshield Trim or Roof Molding Installation

AFFECTED VEHICLES

2012-16 CR-V


Some 2012-16 CR-Vs have studs welded on the inner side of the A-pillar that secure the clips (retainers) holding either the side windshield trim or the roof molding.

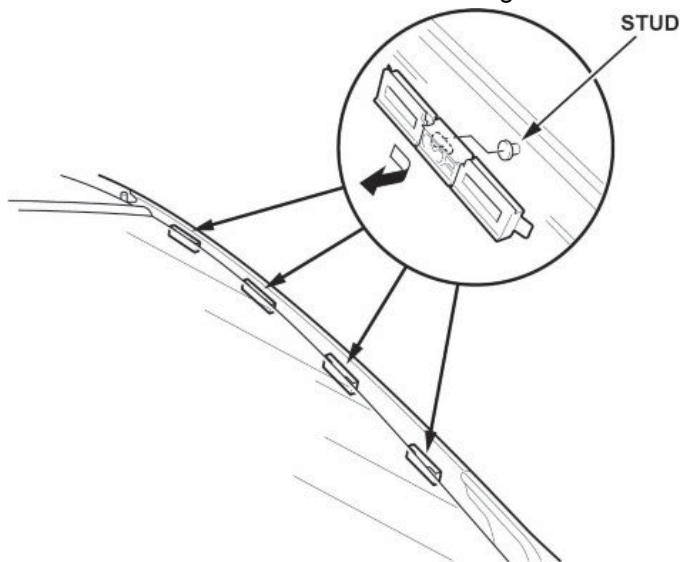

Some replacement front side outer panels do not come with this stud. Alternative clips (retainers) must be ordered and applied to the A-pillar using a two-part epoxy adhesive.

For the installation procedure, refer to the 2015 or 2016 CR-V service information. Go to **Side Windshield Trim Removal and Installation** or **Roof Molding Removal and Installation, Installation**, then follow the procedure under **Except USA Factory Model**.

1. Retainer - Install

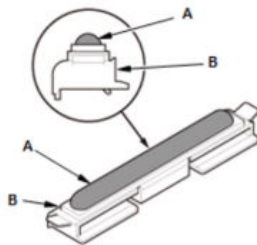

Except USA Factory Model

1. Clean the body bonding surface with a shop towel dampened with isopropyl alcohol. After cleaning, keep oil, grease, and water from getting on the clean surface.
2. Apply the two-part epoxy adhesive (A) on the clip (B) as shown.

A commercially available two-part epoxy adhesive can be used but using the 3M™ Scotch-Weld™ Epoxy Adhesive DP100 is recommended.

When ordering the alternative clips (retainers), use the table below:

Part Number	Description	Quantity	Reference Number
91570-TA0-305	CLIP A, FR. WINDSHIELD SIDE	3	52
91571-TA0-305	CLIP B, FR. WINDSHIELD SIDE	1	53

NOTE

Quantities listed are for one side only.

